HEALTHCARE
Imaging >
Global Support Operations

HOME

Field Service Bulletin No. 22

Order No.: DD+DIS166.02E

1 piece VDRTQ MA1

ADC Solo
Type 5155 / 100

Path Speed CR SP1001
Type 5155 / 200

Rating			When?		
safety relevant	reliability	new function	immediately	next service	as required
	X				X

Please file this document in section 13 of your technical documentation

Replacement of a broken light barrier flag at the Cassette Opener

Symptom

The light barrier flag (see figure beside) of the cassette opener may break when it touches the frame of the cassette opener.

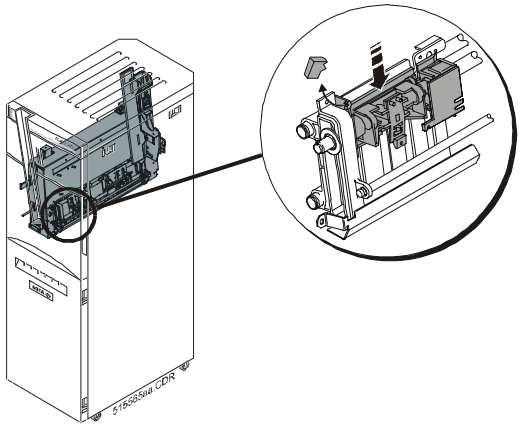

Reason

The cassette opener (LHS) remains in the home position and is not moved to the middle position when the cassette holder is lowered manually.

Solution

Exchange the broken part.
Order number: **CM+9.5146.5911.0**

Spare part can be ordered separately. It is not necessary to order a complete cassette opener!

printed in Germany 07 / 2002

AGFA